
Hardmetals — Palmqvist toughness test

Métaux durs — Méthode d'essai de dureté de Palmqvist

STANDARDSISO.COM : Click to view the full PDF of ISO 28079:2009



PDF disclaimer

This PDF file may contain embedded typefaces. In accordance with Adobe's licensing policy, this file may be printed or viewed but shall not be edited unless the typefaces which are embedded are licensed to and installed on the computer performing the editing. In downloading this file, parties accept therein the responsibility of not infringing Adobe's licensing policy. The ISO Central Secretariat accepts no liability in this area.

Adobe is a trademark of Adobe Systems Incorporated.

Details of the software products used to create this PDF file can be found in the General Info relative to the file; the PDF-creation parameters were optimized for printing. Every care has been taken to ensure that the file is suitable for use by ISO member bodies. In the unlikely event that a problem relating to it is found, please inform the Central Secretariat at the address given below.

STANDARDSISO.COM : Click to view the full PDF of ISO 28079:2009



COPYRIGHT PROTECTED DOCUMENT

© ISO 2009

All rights reserved. Unless otherwise specified, no part of this publication may be reproduced or utilized in any form or by any means, electronic or mechanical, including photocopying and microfilm, without permission in writing from either ISO at the address below or ISO's member body in the country of the requester.

ISO copyright office
Case postale 56 • CH-1211 Geneva 20
Tel. + 41 22 749 01 11
Fax + 41 22 749 09 47
E-mail copyright@iso.org
Web www.iso.org

Published in Switzerland

Contents

Page

Foreword.....	iv
Introduction	v
1 Scope	1
2 Normative references	1
3 Symbols and units	1
4 Test pieces and sample preparation.....	2
4.1 Test piece size and sampling	2
4.2 Surface preparation	2
4.3 Surface condition.....	2
5 Apparatus	3
5.1 General.....	3
5.2 Indentation.....	3
5.3 Indentation and crack measurement	3
6 Procedure and conditions of testing	3
6.1 Indentations.....	3
6.2 Indentation and crack length measurement	3
6.3 Test validity	5
7 Analysis	6
7.1 Vickers hardness	6
7.2 Toughness.....	6
8 Measurement uncertainty	6
9 Test report	7
Annex A (informative) Report pro forma — Palmqvist toughness measurements on hardmetals	8
Bibliography	10

Foreword

ISO (the International Organization for Standardization) is a worldwide federation of national standards bodies (ISO member bodies). The work of preparing International Standards is normally carried out through ISO technical committees. Each member body interested in a subject for which a technical committee has been established has the right to be represented on that committee. International organizations, governmental and non-governmental, in liaison with ISO, also take part in the work. ISO collaborates closely with the International Electrotechnical Commission (IEC) on all matters of electrotechnical standardization.

International Standards are drafted in accordance with the rules given in the ISO/IEC Directives, Part 2.

The main task of technical committees is to prepare International Standards. Draft International Standards adopted by the technical committees are circulated to the member bodies for voting. Publication as an International Standard requires approval by at least 75 % of the member bodies casting a vote.

Attention is drawn to the possibility that some of the elements of this document may be the subject of patent rights. ISO shall not be held responsible for identifying any or all such patent rights.

ISO 28079 was prepared by Technical Committee ISO/TC 119, *Powder metallurgy*, Subcommittee SC 4, *Sampling and testing methods for hardmetals*.

STANDARDSISO.COM : Click to view the full PDF of ISO 28079:2009

Introduction

Good test methods are those which enable a user or manufacturer to clearly discriminate between different materials.

Fracture toughness values are required for three reasons:

- a) for product design and performance assessment;
- b) for selection of materials;
- c) for quality control.

A specific International Standard for the toughness of hardmetals ¹⁾ has not been developed to date, primarily because of the difficulty of introducing stable precracks into these tough but hard materials. However, Palmqvist tests for toughness are widely used because of their perceived apparent simplicity. Cracks are formed at the corners of Vickers hardness indentations and these can be used to calculate a nominal surface toughness value. This value is sensitive to the method of measurement and to the method of surface preparation of the sample. This International Standard outlines good practice to minimize uncertainties due to these issues.

There are several possible methods for the measurement of the fracture toughness of hardmetals. The results can be expressed either as a stress intensity factor, in $\text{MN}\cdot\text{m}^{-3/2}$, or as a fracture surface energy, in $\text{J}\cdot\text{m}^{-2}$. The range of values for typical WC/Co hardmetals is from $7 \text{ MN}\cdot\text{m}^{-3/2}$ to $25 \text{ MN}\cdot\text{m}^{-3/2}$. There is a general inverse trend of hardness against fracture toughness (see [1] and [2] in the Bibliography).

When applied unqualified to hardmetals, “toughness” can have several meanings.

- a) Plane-strain fracture toughness, K_{IC} in $\text{MN}\cdot\text{m}^{-3/2}$, is a value obtained from tests on specimens with appropriate geometries for plane-strain conditions and containing a well-defined geometry of crack. There is no standard method for hardmetals and different organizations use different test methods for introducing the precrack.
- b) Strain-energy release rate (or work of fracture), G , is an alternative expression for toughness, often obtained by converting plane-strain toughness, K , to G [i.e. $G = K^2/E(1 - \nu^2)$, where E is Young's modulus and ν is Poisson's ratio]. G has units of $\text{J}\cdot\text{m}^{-2}$. Again, there is no standard method.
- c) Palmqvist toughness, W , is a value obtained by measuring the total length of cracks emanating from the four corners of a Vickers hardness indentation. For a given indentation load, the shorter the crack, the tougher the hardmetal.
- d) Finally, toughness is also widely used, in a loose sense, to describe the empirical relation between perceived resistance to dynamic impacts. This is neither standardized nor quantified, but is clearly important for many industrial applications of hard materials. Also, principally for hardmetals, it can be more realistically assessed through either fatigue tests or high-rate strength tests, rather than a conventional fracture toughness test.

1) Terminology — There is a range of terms used for this type of material, especially including cemented carbides and/or cermets, as well as hardmetals. The word “hardmetals” has been used in this document. It includes all hard materials based on carbides that are bonded with a metal. In ISO 3252 terminology, “hardmetal” is stated to be “a sintered material characterized by high strength and wear resistance, comprising carbides of refractory metals as the main component together with a metallic binder phase”. “Cemented carbide” is synonymous with “hardmetal”. A “cermet” is defined as “a sintered material containing at least one metallic phase and at least one non-metallic phase, generally of a ceramic nature”.

There is a considerable body of published information on Palmqvist toughness tests for hardmetals (see [5] to [29] in the Bibliography). Palmqvist toughness, W , is a toughness value obtained by measuring the crack lengths at the corners of a Vickers indentation. It can be evaluated by making indentations either at a single load, usually 30 kgf, or from the inverse of the slope of a plot of crack length against load for a range of applied loads. For hardmetals, the crack depth profile is normally of the Palmqvist type, i.e. independent shallow arcs emanating from each indentation corner. The measurement of surface crack length is, however, open to operator error. It is widely recognized that test surfaces are carefully prepared to remove the effects of residual surface stresses (see [8] in the Bibliography). The test also has a poor fracture-mechanics pedigree because of the uncertainties associated with residual stresses introduced by the indentation.

One advantage of the Palmqvist method is that parallel measurements are made of sample hardness, which is required for quality-control purposes. The crack length, and thus toughness measurements, do not therefore require much more effort and can yield equally useful material characterization data, provided the measurements are obtained carefully in line with the methods proposed in this International Standard.

This International Standard is based on a "Good Practice Guide for the Measurement of Palmqvist Toughness" published by the UK National Physical Laboratory in 1998. This International Standard recommends good practice to minimize levels of uncertainty in the measurement process. The procedure has been validated through underpinning technical work within the VAMAS²⁾ framework (see [29] in the Bibliography). An interlaboratory exercise was conducted to generate underpinning technical information on toughness tests for hardmetals. More than ten industrial organizations participated, either by correspondence, supply of materials or by conducting tests. Eight organizations were able to complete Palmqvist tests. Good statistics were obtained on the Palmqvist data that enabled a quantitative assessment of uncertainties to be performed for this relatively simple test. Single-edge precracked beam data was thought to be closest to the "true" value, and the mean values from the Palmqvist test data compared reasonably well with these results. However, care was needed in test piece preparation to ensure a good correlation between data from the Palmqvist tests and the single-edge precracked beam results.

2) VAMAS, Versailles Project on Advanced Materials and Standards, supports trade in high technology products through international collaborative projects aimed at providing the technical basis for drafting codes of practice and specifications for advanced materials. The scope of the collaboration embraces all agreed aspects of enabling science and technology, i.e. databases, test methods, design methods, and materials technology, which are required as a precursor to the drafting of standards for advanced materials. VAMAS activity emphasises collaboration on pre-standards measurement research, intercomparison of test results, and consolidation of existing views on priorities for standardization action. Through this activity, VAMAS fosters the development of internationally acceptable standards for advanced materials by the various existing standards agencies.

Hardmetals — Palmqvist toughness test

1 Scope

This International Standard specifies a method for measuring the Palmqvist toughness of hardmetals and cermets at room temperature by an indentation method. This International Standard applies to a measurement of toughness, called Palmqvist toughness, calculated from the total length of cracks emanating from the corners of a Vickers hardness indentation, and it is intended for use with metal-bonded carbides and carbonitrides (normally called hardmetals, cermets or cemented carbides). The test procedures proposed in this International Standard are intended for use at ambient temperatures, but can be extended to higher or lower temperatures by agreement. The test procedures proposed in this International Standard are also intended for use in a normal laboratory-air environment. They are not intended for use in corrosive environments, such as strong acids or seawater.

2 Normative references

The following referenced documents are indispensable for the application of this document. For dated references, only the edition cited applies. For undated references, the latest edition of the referenced document (including any amendments) applies.

ISO 3878, *Hardmetals — Vickers hardness test*

3 Symbols and units

For the purposes of this document, the following symbols and units apply.

Symbol	Designation	Unit
A	Constant of value 0,002 8	—
d	Indentation-diagonal mean value	mm
d_1, d_2	Indentation-diagonal individual values	mm
E	Young's modulus	$\text{N}\cdot\text{mm}^{-2}$
F	Indentation load (toughness calculations)	N
G	Strain-energy release rate	$\text{J}\cdot\text{m}^{-2}$
H	Hardness	$\text{kgf}\cdot\text{mm}^{-2}$
$\text{HV}(P)$	Vickers hardness at load P (kgf)	$\text{kgf}\cdot\text{mm}^{-2}$
K_{Ic}	Plane-strain fracture toughness	$\text{MN}\cdot\text{m}^{-3/2}$
ℓ_n	Crack length at indent corner	mm
P	Indentation load (Vickers hardness method)	kgf

Symbol	Designation	Unit
T	Total crack length	mm
t_n	Tip-to-tip crack length	mm
W_G	Palmqvist toughness	$\text{N}\cdot\text{mm}^{-1}$ or $\text{J}\cdot\text{m}^{-2}$; $1 \text{ N}\cdot\text{mm}^{-1} = 1\,000 \text{ J}\cdot\text{m}^{-2}$
W_K	Palmqvist fracture toughness	$\text{MN}\cdot\text{m}^{-3/2}$
ν	Poisson's ratio	—

4 Test pieces and sample preparation

4.1 Test piece size and sampling

Any test piece shape can be used, provided that it can be prepared with a flat surface and a flat opposing face for making the indentation. Hot mounting in a press gives flat and parallel faces. Cold mounting does not give flat and parallel faces.

Diamond slicing or electrospark discharge machines are convenient to use for this purpose. However, the surfaces shall then be polished. It is recommended that 0,2 mm of material be removed before the final polish to ensure that material typical of the bulk is tested. For example, the ISO Vickers hardness test for hardmetals (see ISO 3878) specifies the removal of 0,2 mm.

NOTE It has also been suggested, in a dissertation by M. Heino (UMIST) [19], that the test piece should be at least as thick as ten times the crack length. Thinner test pieces might not give representative results because the stress state will be dependent on the amount of material supporting the indentation and its associated cracks. It can be convenient to mount the test pieces in hot-setting resins to directly provide flat and parallel faces. However, if the test pieces are to be subsequently annealed to remove surface residual stresses then this can be a disadvantage, since the test piece has to be removed from the mount to put it in the annealing furnace (typically 800 °C for 1 h in a vacuum).

4.2 Surface preparation

It is essential to prepare a surface which is flat so that the indentation is of regular geometry. It is recommended that the flatness be confirmed after the indentation is made, by measuring the diagonal of the Vickers indentation in orthogonal directions. If the diagonals differ by more than 1 %, the surface is not flat and the test should be declared invalid.

Grinding should be done wet with metal-bonded 40 µm diamond-impregnated discs, since silicon carbide wheels introduce larger residual stresses than diamond. The grinding stage produces a planar surface which then needs to be polished. The minimum recommended sequence of diamond abrasives is at least 30 µm, followed by 6 µm and 1 µm. Napless cloths should be used for the final stages.

NOTE This process will produce stress-free surfaces if the final polishing stages are sufficiently long to remove all grinding damage. However, it is difficult to prove that this is the case without extensive comparisons of results from as-polished and polished/annealed test pieces.

4.3 Surface condition

It has been shown that surfaces free of residual stress are required for consistent results (see [8] in the Bibliography). No polishing procedure can guarantee a stress-free surface without tedious systematic measurements which are not feasible on a regular basis. Usually, test pieces are polished so that the microstructure can be observed and then annealed at 800 °C for 1 h in a vacuum, following the studies published by Exner [8].

NOTE The newer grades of material with very fine WC grain sizes (less than about $0,8\ \mu\text{m}$ as measured by the linear intercept technique on polished and etched sections) developed in recent years since Exner's work are likely to have even higher surface residual stresses. It might be that longer annealing times or even higher temperatures are required for these materials. It would probably be sensible to recommend a higher temperature, but future research is needed to confirm this recommendation. The annealing stage adds to the complexity of the sample preparation process, but ensures that the surface is free from residual stresses.

If measurements are performed on as-polished surfaces without an anneal, this shall be indicated in the test report.

5 Apparatus

5.1 General

The indentations shall be introduced into the test piece of interest using test machines calibrated according to national standards. The shape of the indentation should be checked regularly for damage to the indenter tip. The diagonal and crack dimensions can be measured using a microscope attached to the indentation test machine or separately, but it shall have been calibrated against a standard.

5.2 Indentation

Indentation shall be carried out on a Vickers hardness testing machine in accordance with the method in ISO 3878 for the Vickers hardness test and for verification of the Vickers hardness testing machine. A certified diamond indenter should be used and accredited by a national body.

5.3 Indentation and crack measurement

Indent diagonals and cracks should be measured using an accredited microscope. The image can be projected onto a screen which has been calibrated using a stage graticule traceable to national standards.

6 Procedure and conditions of testing

6.1 Indentations

Indentations shall be made in a deadweight hardness machine which is calibrated at least annually. The recommended procedure is to make indentations using a Vickers diamond indenter with one load, rather than a series of loads. The indentations should be made at 30 kgf or, if no cracks are visible at this load, at 100 kgf. Sometimes, even 100 kgf will not provide cracks. Until further research is conducted, this International Standard recommends that measurements at loads greater than 100 kgf are not valid. Two indentations shall be made initially and the toughness values for each indentation shall be compared. If they are within the measurement uncertainty associated with the procedure (see Clause 8), the two measurements are considered satisfactory. If they differ by more than this uncertainty, a third indentation shall be made and the result reported as an average with an associated standard deviation. If the two measurements are within the estimated measurement uncertainty, then an average value of the two measurements is reported without a standard deviation.

It is also possible to make the measurement of toughness by indenting with a series of loads and plotting the total crack lengths obtained against the load for each indentation. If this method is used to obtain a value for W_G and W_K , then it shall be noted in the test report.

6.2 Indentation and crack length measurement

It is recommended that the indentation diagonal and crack lengths be measured optically at a magnification of at least $\times 500$ (see Figure 1). The magnification used shall be calibrated for each measurement session using a traceable grid.

Either take photographs of the indentation and cracks or project the image onto a measurement screen if a suitable microscope is available. Measure both indentation diagonals. Record both values. If the diagonals differ by more than 2 mm at $\times 500$ magnification, the test should be repeated because of a lack of flatness of the test piece.

There are two methods for measuring the crack length. The results are independent of the method (see [28] in the Bibliography). Either of the following methods can be used.

a) Method A:

Measure the distance from crack tip to crack tip for both diagonal directions. The total crack length is the sum of both these values minus the sum of the indentation diagonals (see Figure 1).

NOTE If the magnification is $\times 500$, this method is impractical, because the crack tip to crack tip distance is usually too large to include in one image.

b) Method B:

Measure individual crack lengths at $\times 500$ from the indentation corner to crack tip for each of the four cracks. Add them to give a total crack length. If the crack root does not coincide with the tip of the indentation diagonal, measure the crack length from where the crack initiates along the edge of the indentation.

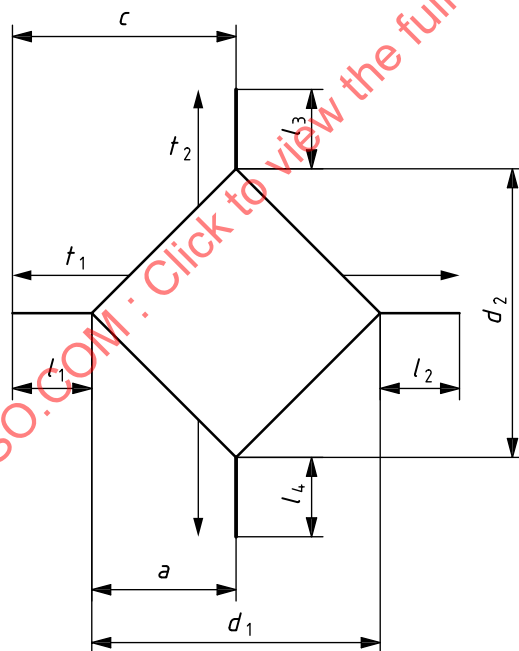


Figure 1 — Schematic diagram of Palmqvist indentation characteristics

Hardness:

$$H = \frac{1,854 \, 4 \times P}{\left[(d_1 + d_2) \times \frac{1}{2} \right]^2} \quad (1)$$

The indentation load P is usually 30 kgf.

The following are alternative methods for measuring crack length, ℓ_n , and toughness, W (see Figure 1).

1) Alternative method 1:

- i) Measure crack tip to crack tip:

$$t_1 = \ell_1 + \ell_2 + d_1 \quad (2)$$

$$t_2 = \ell_3 + \ell_4 + d_2 \quad (3)$$

- i) Measure indentation diagonals, d_1 , d_2 ,

- ii) Equation for Palmqvist toughness:

$$W_G = \frac{P}{(t_1 - d_1) + (t_2 - d_2)} \quad (4)$$

2) Alternative method 2:

- i) Measure crack lengths ℓ_1 to ℓ_4 from crack tip to indentation corner:

$$T = \ell_1 + \ell_2 + \ell_3 + \ell_4, \text{ or} \quad (5)$$

$$T = (t_1 - d_1) + (t_2 - d_2) \quad (6)$$

- ii) Equation for Palmqvist toughness:

$$W_G = \frac{P}{T} \quad (7)$$

6.3 Test validity

If there is more than one crack emanating from the indentation corner, the indentation should be ignored, as the measurement is invalid.

If the total crack length is less than 40 μm , the test should be considered of greater uncertainty and a special note should be made in the test report.

NOTE For a 30 kgf load, this corresponds to a toughness value, W_G , of 7 360 $\text{N}\cdot\text{m}^{-1}$ (or about 25 $\text{MN}\cdot\text{m}^{-3/2}$ for W_K) for a material with a hardness of 1 000 HV30. These materials are likely to have coarse microstructures and the individual crack lengths at each indentation corner will be no more than one or two grains long. This is too short to be confident that the crack is sampling a representative volume of hardmetal.

If the indentation diagonals differ by more than 4 μm for an indentation load of 30 kgf, the surface is not sufficiently flat and the test is invalid; 4 μm at $\times 500$ magnification is 2 mm.

7 Analysis

7.1 Vickers hardness

Take the average value of the two diagonals, in mm, and convert to a true value, d , in mm, by dividing by the calibrated value for the magnification. The hardmetal Vickers hardness, HV, is given by the following equation:

$$HV = \frac{1,854\ 4 \times P}{d^2} \quad (8)$$

Express as HV30 or HV100 corresponding to the load used, in kgf.

NOTE Various hardness standards are converting to $N \cdot mm^{-2}$ rather than $kgf \cdot mm^{-2}$. At present, the International Standard for the test method for Vickers hardness (ISO 6507-1) uses kgf and therefore this convention is retained in this International Standard.

The hardness number shall be expressed without decimal places, i.e. to four significant figures if greater than 1 000 HV, or three significant figures if less than 1 000 HV.

7.2 Toughness

Two different values for toughness can be calculated, Palmqvist toughness, W_G , and Palmqvist fracture toughness, W_K (see the introduction).

The following equation is for Palmqvist toughness, Method A (single indentation load):

$$W_G = \frac{F}{T} \quad (9)$$

The following equation is for Palmqvist fracture toughness, Method B (multiple loads):

$$W_K = A\sqrt{HV} \times \sqrt{W_G} \quad (10)$$

For Method B (multiple loads), the ratio F/T is the inverse of the slope of a plot of total crack length against load. HV is expressed in $N \cdot mm^{-2}$ and A has the value 0,002 8.

Calculate both values and report with a mean value if two indentations/samples are made, and a mean value and standard deviation if three or more indentations/samples are made.

The results shall be reported to three significant figures only.

8 Measurement uncertainty

The ability of the Palmqvist method to differentiate between materials depends on the hardness. For 2 000 HV the uncertainty is $\pm 10 N \cdot mm^{-1}$, for 1 500 HV it is $\pm 110 N \cdot mm^{-1}$, and for 1 250 HV it is $\pm 550 N \cdot mm^{-1}$.

9 Test report

It is recommended that the pro forma given in Annex A be used for the test report, which shall contain at least the following information:

- a) a reference to this International Standard;
- b) material type and condition;
- c) test piece identification;
- d) location and direction of sampling of the test piece;
- e) surface preparation method;
- f) indentation load;
- g) analysis method;
- h) result obtained in tabular or computer file format;
- i) validity assessment;
- j) all options not specified in this International Standard, or regarded as optional;
- k) details of any occurrence which may have affected the result.

Annex A (informative)

Report pro forma — Palmqvist toughness measurements on hardmetals

A.1 General

A report pro forma for Measurement Report covering Palmqvist toughness tests on hardmetals is given in A.2. Typical inputs are included for guidance.

A.2 Report pro forma

Table A.1 — Material

Reference	Description	Comment
Material	Source	Marshalls Hard Metals
	Identifier	MHM15C
	Composition	WC/6 %Co
	Coercivity	50 kA·m ⁻¹
	Magnetic moment	0,80 μTm ³ ·kg ⁻¹
	Form	Rectangular block
	Heat treatment/processing	As-sintered
Test piece Information	Size	40 × 5 × 20 mm
	Polished area	40 × 20 mm
Procedure	Applicable standard(s)	ISO XYZ

Table A.2 — Testing organization

Organization:	National Physical Laboratory
Name:	E. Bennett
Signature:	
Date:	26 February 2009